

TITLE : Software Log**MODEL**: Esprecious 3.0 11(L) / 12(L) / 21(L) / 22(L)**DATE** : 2025-07-01**Reason for sending you this information**

For our Esprecious 3.0 machine we have the following updates of the software. The updates for the Esprecious 3.0 are available by type and can be downloaded from our website.

Date	Version	Application 002.105.023	GUI 002.102.017	Recipes 002.103.024	Configuration			
					11 / 12 002.104.046	11L / 12L 002.104.044	21 / 22 002.104.047	21L / 22L 002.104.045
2025-06-24	1.05	0.32	0.49	0.22	0.25	0.25	0.25	0.25
2025-02-21	1.04	0.27	0.43	0.19	0.24	0.24	0.24	0.24
2024-12-24	1.03	0.27	0.42	0.19	0.24	0.24	0.24	0.24

Software version 1.05 (24-06-2025)

► *This modification relate to the all Esprecious 3.0 machines.*

- the possibility to check the weight of an instant ingredient
- strength and volume controls now work correctly when switched on or off independently
- several text improvements in different languages
- added a screen for media specifications (background, banner, etc.), including size and file type
- rreduced the water flow for hot water on the Americano recipe
- added a higher volume (900 ml max.) for the following drinks:
 - Lungo & double Lungo
 - Americano & double Americano
 - Chocolate & double Chocolate
 - Hot water
 - Hot milk
- added a high-pressure pump routine that activates the pump briefly if it hasn't been used for a while
- when installing the Esprecious with a FreshMilk unit, the milk pump calibration is added to the initial setup process
- option to choose a file when importing settings enabled
- the default number during grinder calibration has been adjusted.bugs fixed:
 - Grinder 1: 16,5 gram
 - Grinder 2: 20,5 gram
- minimum amount of coffee in drink setting is now 5 gram
- if an ingredient is changed, you now get a message that all beverages with that ingredient will be erased if you proceed
- solved bug when using settings via USB during first installation that grinder calibration was not mandatory
- grinders now need to be calibrated when a setting file is used during the first installation
- fixed a bug that occurred when calibrating beverages prepared in multiple cycles
- fixed a bug that occurred when cancelling a beverage
- fixed a bug that caused the software to freeze when adjusting the beverage volume
- fixed a bug in the brewer cleaning process when initiated from the quick menu

The first serial number produced with this update: **10056176**

TITLE : Software Log

MODEL: Esprecious 3.0 11(L) / 12(L) / 21(L) / 22(L)

DATE : 2025-07-01

Reason for sending you this information

For our Esprecious 3.0 machine we have the following updates of the software.
The updates for the Esprecious 3.0 are available by type and can be downloaded from our website.

Software version 1.04 (21-02-2025)

► *This modification relate to the all Esprecious 3.0 machines.*

- bug fix for unnecessary temperature notification or temperature block on the screen

Esprecious machines with the following serial numbers (in stock) have been updated with the latest software:

10000074,
10005845 to 10005848 and
10008122 to 10008131
10008138 to 10008171
10010074 to 10010091

The first serial number produced with this update: **10010092**

Software version 1.03 (24-12-2024)

► *This modification relate to all Esprecious 3.0 machines.*

- start first production
